





Document No.	PO-00347
Version	C


QFN4x4_31L_EP2_S PACKAGE OUTLINE

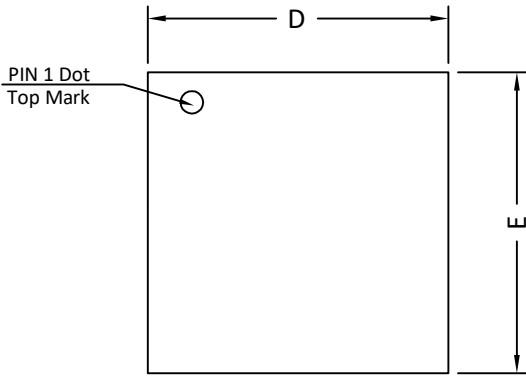

TOP VIEW

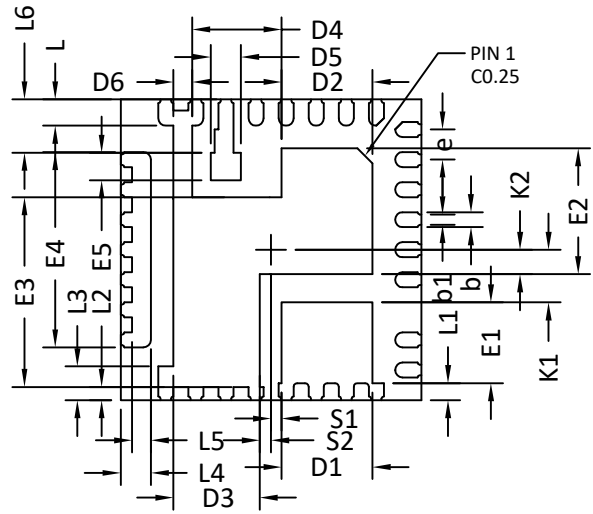


BOTTOM VIEW

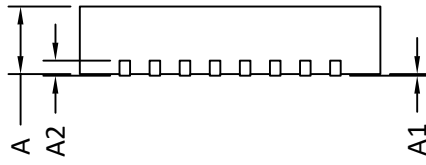

SIDE VIEW

RECOMMENDED LAND PATTERN

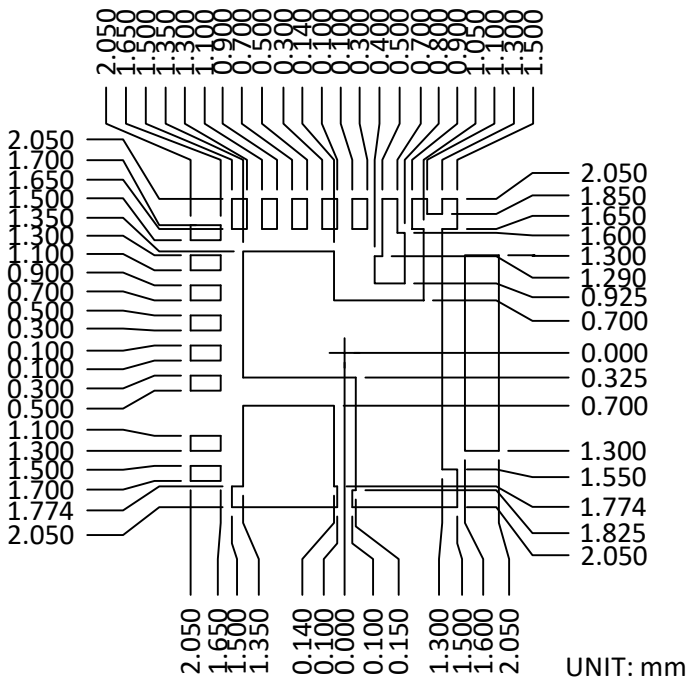

SYMBOLS	DIMENSION IN MM			DIMENSION IN INCHES		
	MIN	NOM	MAX	MIN	NOM	MAX
A	0.80	0.90	1.00	0.031	0.035	0.039
A1	0.00	-	0.05	0.000	-	0.002
A2	0.20REF			0.008REF		
D	3.90	4.00	4.10	0.154	0.157	0.161
E	3.90	4.00	4.10	0.154	0.157	0.161
D1	1.16	1.21	1.26	0.046	0.048	0.050
D2	1.16	1.21	1.26	0.046	0.048	0.050
D3	1.10	1.15	1.20	0.043	0.045	0.047
D4	1.14	1.19	1.24	0.045	0.047	0.049
D5	0.35	0.40	0.45	0.014	0.016	0.018
D6	0.20	0.25	0.30	0.008	0.010	0.012
E1	1.02	1.07	1.12	0.040	0.042	0.044
E2	1.63	1.68	1.73	0.064	0.066	0.068
E3	2.48	2.53	2.58	0.097	0.099	0.101
E4	2.55	2.60	2.65	0.100	0.102	0.104
E5	0.32	0.37	0.42	0.012	0.014	0.016
K1	0.65	0.70	0.75	0.026	0.028	0.030
K2	0.28	0.33	0.38	0.011	0.013	0.015
S1	0.09	0.14	0.19	0.004	0.006	0.007
S2	0.10	0.15	0.20	0.004	0.006	0.008
L	0.30	0.35	0.40	0.012	0.014	0.016
L1	0.18	0.23	0.28	0.007	0.009	0.011
L2	0.13	0.18	0.23	0.005	0.007	0.009
L3	0.40	0.45	0.50	0.016	0.018	0.020
L4	0.35	0.40	0.45	0.014	0.016	0.018
L5	0.20	0.25	0.30	0.008	0.010	0.012
L6	0.66	0.71	0.76	0.026	0.028	0.030
b	0.15	0.20	0.25	0.006	0.008	0.010
b1	0.09	0.14	0.19	0.004	0.006	0.007
e	0.40BSC			0.016BSC		

NOTE:
CONTROLLING DIMENSION IS MILLIMETER.
CONVERTED INCH DIMENSIONS ARE NOT NECESSARILY EXACT.