





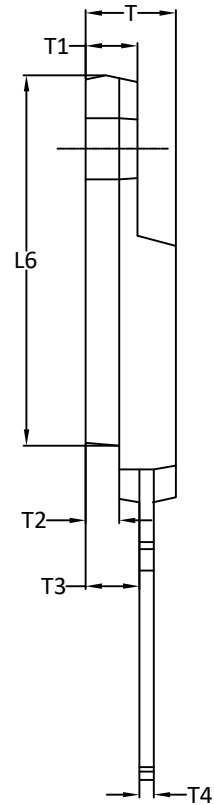

TO3PF PACKAGE OUTLINE

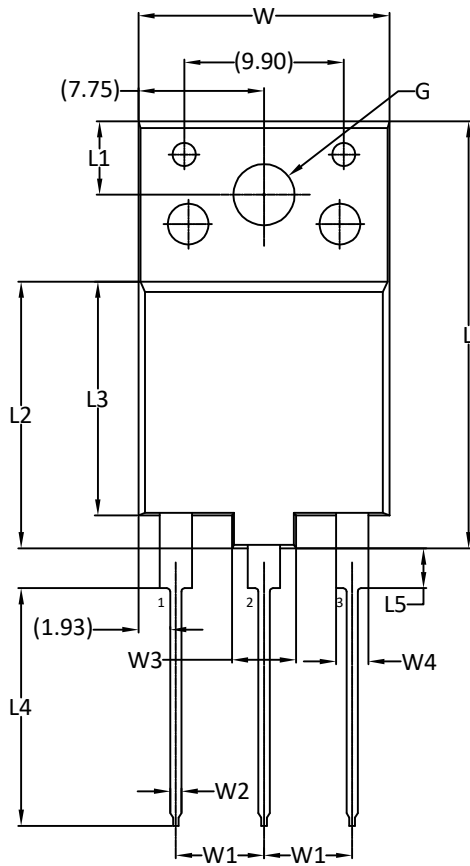

RECOMMENDATION OF HOLE PATTERN

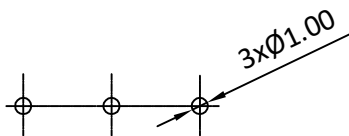

UNIT: mm

SYMBOLS	DIMENSION IN MM			DIMENSION IN INCHES		
	MIN	NOM	MAX	MIN	NOM	MAX
W	15.30	15.35	15.70	0.602	0.604	0.618
W1	5.15	5.45	5.75	0.203	0.215	0.226
W2	0.65	0.82	0.95	0.026	0.032	0.037
W3	3.80	3.96	4.20	0.150	0.156	0.165
W4	1.80	2.15	2.20	0.071	0.085	0.087
L	26.30	26.45	26.70	1.035	1.041	1.051
L1	4.40	4.50	4.60	0.173	0.177	0.181
L2	16.30	16.50	16.70	0.642	0.650	0.657
L3	14.30	14.45	14.70	0.563	0.569	0.579
L4	14.60	14.65	15.00	0.575	0.577	0.591
L5	2.30	2.36	2.70	0.091	0.093	0.106
L6	22.80	22.95	23.20	0.898	0.904	0.913
T	5.30	5.50	5.70	0.209	0.217	0.224
T1	2.80	3.05	3.20	0.110	0.120	0.126
T2	1.80	2.00	2.20	0.071	0.079	0.087
T3	3.10	3.30	3.50	0.122	0.130	0.138
T4	0.80	0.95	1.10	0.031	0.037	0.043
G(φ)	3.40	3.54	3.80	0.134	0.139	0.150

NOTE:

1. PACKAGE BODY SIZES EXCLUDE MOLD FLASH AND GATE BURRS. MOLD FLASH SHOULD BE LESS THAN 6 MIL.
2. TOLERANCE 0.100 MILLIMETERS UNLESS OTHERWISE SPECIFIED.
3. CONTROLLING DIMENSION IS MILLIMETER.
CONVERTED INCH DIMENSIONS ARE NOT NECESSARILY EXACT.
4. "()" MEANS REFERENCE DIMENSION.